

# 110/113/114/115/116/117

True-rms Multimeter

Calibration Information

September 2006 Rev. 2, 5/20

©2006-2020 Fluke Corporation. All rights reserved.

All product names are trademarks of their respective companies.

Shop for Fluke products online at: **[www.MyFlukeStore.com](http://www.MyFlukeStore.com)** 1.888.610.7664

## LIMITED WARRANTY AND LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is three years and begins on the date of shipment. Parts, product repairs, and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries, or to any product which, in Fluke's opinion, has been misused, altered, neglected, contaminated, or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption.

Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available only if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country.

Fluke's warranty obligation is limited, at Fluke's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to a Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that service center, with a description of the difficulty, postage and insurance prepaid (FOB Destination). Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that failure was caused by neglect, misuse, contamination, alteration, accident, or abnormal condition of operation or handling, including overvoltage failures caused by use outside the product's specified rating, or normal wear and tear of mechanical components, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, ARISING FROM ANY CAUSE OR THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court or other decision-maker of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.

11/99

# ***Table of Contents***

| <b>Title</b>                                     | <b>Page</b> |
|--------------------------------------------------|-------------|
| Introduction .....                               | 1           |
| How to Contact Fluke.....                        | 1           |
| Safety Information.....                          | 1           |
| Specifications .....                             | 1           |
| Maintenance .....                                | 2           |
| Fuse Test (115, 117) .....                       | 2           |
| Battery and Fuse Replacement .....               | 3           |
| Cleaning.....                                    | 4           |
| Features.....                                    | 5           |
| Performance Tests.....                           | 6           |
| Required Equipment.....                          | 6           |
| Display Test .....                               | 7           |
| 110/114/115/116/117 .....                        | 7           |
| 113 .....                                        | 7           |
| Backlight Test .....                             | 7           |
| Keypad Test.....                                 | 7           |
| 110/114/115/116/117 .....                        | 7           |
| 113 .....                                        | 7           |
| Preparing for the Performance Tests.....         | 8           |
| Testing Temperature (116 only) .....             | 8           |
| Testing the VoltAlert Function (117 only).....   | 12          |
| Calibration Adjustment.....                      | 14          |
| Calibration Adjustment Password.....             | 14          |
| Changing the Password .....                      | 14          |
| Restoring the Default Password.....              | 15          |
| Meter Buttons Used in the Calibration Steps..... | 16          |
| Calibration Adjustment Procedure .....           | 16          |
| Replacement Parts .....                          | 19          |

## **Introduction**

### **Warning**

**To prevent electric shock or personal injury, do not perform the calibration verification tests or calibration procedures described in this manual unless you are qualified to do so. The information provided in this document is for the use of qualified personnel only.**

This Calibration Information provides the information necessary to adjust and verify the performance of the Fluke Models 110, 113, 114, 115, 115C, 116, 116C, 117, and 117C True RMS Multimeter (the Meter or Product). When specific models are noted in this manual, the “C” version is also included. For example, when the listed model is 115, the instructions are applicable to the 115C as well.

## **Safety Information**

General Safety Information is in the printed Safety Information document that ships with the Product and at More specific safety information is listed where applicable.

## **Specifications**

For complete Specifications, refer to the *110/113/114/115/117 Users Manual* or *116 Users Manual* at

## Maintenance

Maintenance of the Meter consists of battery and fuse replacement, as well as case cleaning.

### Fuse Test (115, 117)

To test the fuse:


1. Set the rotary switch to  $\Omega$ .
2. Plug a test lead into the  $\frac{V}{\Omega}$  jack and touch the probe to the 10A jack, as shown in Figure 1.

If the display shows a resistance value in the range of that shown in Figure 1, the fuse is good.

If the display reads  $\Omega L$ , replace the fuse and test again.

If the display shows any other value, have the Meter serviced. See *How to Contact Fluke* earlier in this document.

**Figure 1. Test the Fuse**

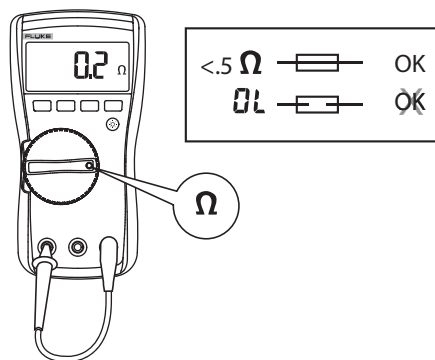

## Battery and Fuse Replacement

### ⚠⚠ Warning

To prevent shock, injury, or damage to the Meter:

- Remove test leads from the Meter before opening the case or battery door.
- Use ONLY a fuse with the amperage, interrupt voltage, and speed ratings specified.

## Static Awareness



Semiconductors and integrated circuits can be damaged by electrostatic discharge during handling. This notice explains how to minimize damage to these components.

1. Understand the problem.
2. Learn the guidelines for proper handling.
3. Use the proper procedures, packaging, and bench techniques.


Follow these practices to minimize damage to static sensitive parts.

### ⚠⚠ Warning

**To prevent electric shock or personal injury.  
De-energize the product and all active circuits  
before opening a product enclosure, touching or  
handling any PCBs or components.**



- Minimize handling.
- Handle static-sensitive parts by non-conductive edges.
- Do not slide static-sensitive components over any surface.
- When removing plug-in assemblies, handle only by non-conductive edges.
- Never touch open-edge connectors except at a static-free work station.

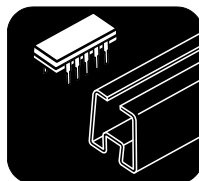


- Keep parts in the original containers until ready for use.
- Use static shielding containers for handling and transport.
- Avoid plastic, vinyl, and Styrofoam® in the work area.



- Handle static-sensitive parts only at a static-free work station.
- Put shorting strips on the edge of the connector to help protect installed static-sensitive parts.
- Use anti-static type solder extraction tools only.
- Use grounded-tip soldering irons only.

See Figure 2 for disassembly.

**Figure 2. Disassembly**

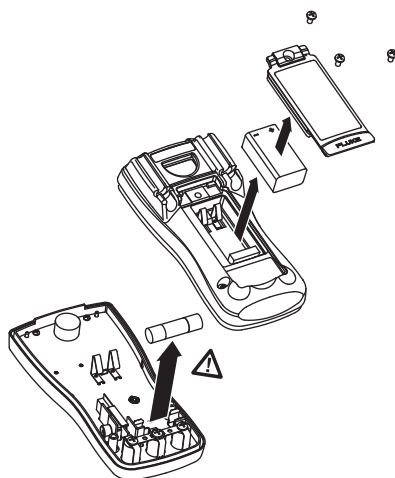

To remove the battery door for battery replacement:

1. Remove the test leads from the Meter.
2. Remove the battery door screw.
3. Use the finger recess to lift the door slightly.
4. Lift the door straight up to separate it from the case.
5. The battery fits inside the battery door, which is then inserted into the case, bottom edge first, until it is fully seated. Do not attempt to install the battery directly into the case.
6. Install and tighten battery door screw.

To open the case for fuse replacement:

1. Remove the test leads from the Meter.
2. Remove the Meter from its holster.
3. Remove two screws from the case bottom.
4. Separate the case bottom from the case top.
5. Remove the fuse from its holder and replace it with an 11 A, 1000 V, FAST fuse having a minimum interrupt rating of 17 000 A. Use only Fluke PN 803293.
6. To re-assemble the Meter, first attach the case bottom to the case top, then install the two screws. Finally, insert the Meter into its holster.

## **Cleaning**

Wipe the case with a damp cloth and mild detergent. Dirt or moisture in the terminals can affect readings.

## Features

Table 1 is a list of the features for each Meter.

Table 1. Features

| Switch Position                                                                                                             | Measurement Function                                                                                                                                                               | 110 | 113 | 114 | 115 | 116 | 117 |
|-----------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----|-----|-----|-----|-----|
| OFF                                                                                                                         | The Meter is turned off.                                                                                                                                                           | ●   | ●   | ●   | ●   | ●   | ●   |
| AUTO-V LoZ                                                                                                                  | Automatically selects ac or dc volts based on the sensed input with a low impedance input.                                                                                         |     |     | ●   |     | ●   | ●   |
|  Hz                                        | AC voltage from 0.06 V to 600 V.                                                                                                                                                   | ●   |     | ●   | ●   | ●   | ●   |
|                                                                                                                             | Frequency from 5 Hz to 100 kHz.                                                                                                                                                    |     |     |     | ●   | ●   | ●   |
|                                            | DC voltage from 0.001 V to 600 V.                                                                                                                                                  | ●   |     | ●   | ●   | ●   | ●   |
|                                            | AC voltage from 6.0 to 600 mV, dc-coupled.<br>DC voltage from 0.1 to 600 mV.                                                                                                       | ●   |     | ●   | ●   | ●   | ●   |
| $\Omega$                                                                                                                    | Ohms from 0.1 $\Omega$ to 40 M $\Omega$ .                                                                                                                                          | ●   |     | ●   | ●   | ●   | ●   |
|                                                                                                                             | Ohms from 0.1 $\Omega$ to 60 k $\Omega$ .                                                                                                                                          |     | ●   |     |     |     |     |
|                                            | Continuity beeper turns on at <20 $\Omega$ and turns off at >250 $\Omega$ .                                                                                                        | ●   | ●   | ●   | ●   | ●   | ●   |
|  <i>CHEK</i>                               | LoZ low impedance measurement function to simultaneously test for voltage or continuity.                                                                                           |     | ●   |     |     |     |     |
|                                           | Diode Test. Displays <b>OL</b> above 2.0 V.                                                                                                                                        |     | ●   |     | ●   | ●   | ●   |
|                                          | Farads from 1 nF to 9999 $\mu$ F.                                                                                                                                                  |     | ●   |     | ●   | ●   | ●   |
|  Hz                                      | AC current from 0.1 A to 10 A (>10 to 20 A, 30 seconds on, 10 minutes off). >10.00 A display flashes. >20 A, <b>OL</b> is displayed. DC-coupled.<br>Frequency from 45 Hz to 5 kHz. |     |     |     | ●   |     | ●   |
|                                          | DC current from 0.001 A to 10 A (>10 A to 20 A, 30 seconds on, 10 minutes off). >10.00 A display flashes. >20 A, <b>OL</b> is displayed.                                           |     |     |     | ●   |     | ●   |
|                                          | DC current from 0.1 to 600 $\mu$ A. AC current from 6.0 to 600 $\mu$ A. DC-coupled.                                                                                                |     |     |     |     | ●   |     |
|                                          | Temperature from -40 °C to 400 °C (-40 °F to 752 °F) with K-type thermocouple                                                                                                      |     |     |     |     | ●   |     |
| Volt Alert                                                                                                                  | Non-contact sensing of ac voltage.                                                                                                                                                 |     |     |     |     |     | ●   |
| Note: All ac functions and Auto-V LoZ are true-rms. AC voltage is ac-coupled. Auto-V LoZ, AC mV and AC amps are dc-coupled. |                                                                                                                                                                                    |     |     |     |     |     |     |

## Performance Tests

### Warning

To prevent electric shock, do not perform the performance test procedures unless the Meter is fully assembled.

The following performance tests verify the complete operation of the Meter and check the accuracy of each Meter function against its specifications. The recommended calibration interval is 12 months. If the Meter fails any part of the test, calibration adjustment and/or repair is indicated.

In the performance tests, the Meter is referred to as the device under test (DUT).

See Table 1 for a list of the features for each Meter.

## Required Equipment

Table 2 is a list of the equipment required to conduct a performance test on the Meter.

**Table 2. Equipment Requirements**

| Equipment                                                              | Measurement Function | Range <sup>[1]</sup> |
|------------------------------------------------------------------------|----------------------|----------------------|
| 5522 Multi-product Calibrator (or equivalent)                          | DC Volts             | 10 mV to 600 V       |
|                                                                        | DC Current           | 600 $\mu$ A to 10 A  |
|                                                                        | AC Volts             | 6 mV to 600 V        |
|                                                                        | AC Current           | 600 $\mu$ A to 10 A  |
|                                                                        | Resistance           | 0 to 30 M $\Omega$   |
|                                                                        | Capacitance          | 9 to 900 $\mu$ F     |
|                                                                        | Temperature          | 0 °C to 400 °C       |
|                                                                        | Frequency            | 2 V, 50 kHz          |
| Fluke 80 AK<br>K-type Thermocouple Adapter Accessory                   | Temperature          | NA                   |
| K-type Thermocouple, mini-plug on both ends                            | Temperature          | NA                   |
| Double Banana plug                                                     | VoltAlert            | NA                   |
| [1] For accuracy specifications, see the Users Manual for the product. |                      |                      |

## Display Test


### 110/114/115/116/117

Push **HOLD** and turn the rotary switch to the  $\tilde{V}^{Hz}$  position. Compare the display with the example in Figure 3. Check all segments for clarity and contrast.

### 113

Push **HOLD** and turn the rotary switch to the  $\checkmark$  *CHEK* position. Compare the display with the example in Figure 3. Check all segments for clarity and contrast.

Figure 3. Display Segments

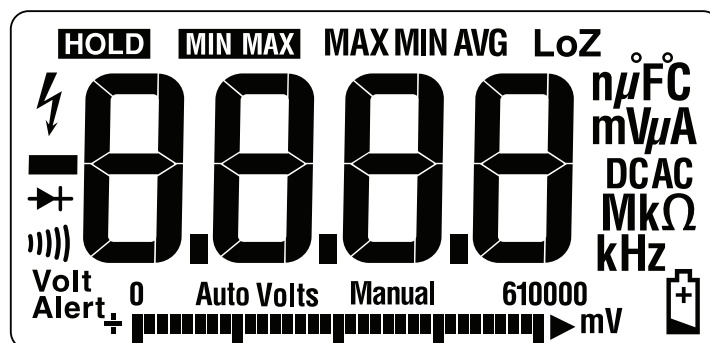

## Backlight Test

To test the backlight, press  $\odot$  and verify that the backlight turns on.

## Keypad Test

### 110/114/115/116/117

To test the keypad:

1. Turn the rotary switch to  $\tilde{V}$ .
2. Push each button separately.  
Each button push should cause the Meter to beep and activate a display annunciator.
3. To reset the Meter, turn the rotary switch to **Off** and then back to the **On** position.

### 113

To test the keypad:

1. Turn the Meter to  $\Omega$   $\rightarrow$ .
2. Push each button separately.  
Each button push should cause the Meter to beep and activate a display annunciator.
3. To reset, turn off the Meter, and then back to any function position.

## Preparing for the Performance Tests

### ⚠⚠ Warning

To prevent possible electric shock or personal injury:

- Do not perform the following procedures unless qualified to do so. Some procedures involve the use of high voltages.
- Before handling the test connections and in between tests, make sure the calibrator is in standby mode (STBY).

To prepare for the performance test:

1. Make sure that you have the required equipment (see Table 2).
2. Warm up the calibrator as required by its specifications.
3. Allow the temperature of the DUT to stabilize at room temperature:  $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$  ( $73\text{ }^{\circ}\text{F} \pm 9\text{ }^{\circ}\text{F}$ )
4. Check the fuses and battery and replace them if necessary. See *Fuse Test (115, 117)* and *Battery and Fuse Replacement*.

To verify the accuracy of the DMM functions, do the following:

1. Connect the Calibrator to the **V $\Omega$**  and **COM** input terminals on the Meter.
2. Turn the rotary switch to the function listed in each step of Table 3 (110, 114, 115, 116, 117) or Table 4 (113).
3. Apply the input level for each step listed in Table 3 (110, 114, 115, 116, 117) or Table 4 (113).
4. Compare the reading on the Meter display with the Display Reading in Table 3 (110, 114, 115, 116, 117) or Table 4 (113).

If the display reading falls outside of the range shown, the Meter requires calibration adjustment or repair.

## Testing Temperature (116 only)

Connect the K-type thermocouple to the temperature input of the Meter and temperature calibrator. To ensure an accurate measurement, the Meter and the thermocouple connector must be at the same temperature. After connecting the thermocouple to the Meter, allow the junctions to stabilize before recording the displayed reading. This can take several minutes, depending on temperature gradients.

**Table 3. DMM Performance Tests: 110/114/115/116/117**

| Step | Function         | Range   | Applied        | Display Reading <sup>[1]</sup> |     |     |     |     |
|------|------------------|---------|----------------|--------------------------------|-----|-----|-----|-----|
|      |                  |         |                | 110                            | 114 | 115 | 116 | 117 |
| 1.   | $\Omega$<br>Ohms | 600.0   | 0.0 $\Omega$   | 0.0 to 0.2                     |     |     |     |     |
| 2.   |                  | 600.0   | 500 $\Omega$   | 495.3 to 504.7                 |     |     |     |     |
| 3.   |                  | 6.000 k | 5 k $\Omega$   | 4.954 to 5.046                 |     |     |     |     |
| 4.   |                  | 60.00 k | 50 k $\Omega$  | 49.54 to 50.46                 |     |     |     |     |
| 5.   |                  | 600.0 k | 500 k $\Omega$ | 495.4 to 504.6                 |     |     |     |     |
| 6.   |                  | 6.000 M | 5 M $\Omega$   | 4.954 to 5.046                 |     |     |     |     |
| 7.   |                  | 40.00 M | 10 M $\Omega$  | 9.48 to 10.52                  |     |     |     |     |
| 8.   |                  | 40.00 M | 30 M $\Omega$  | 28.48 to 31.52                 |     |     |     |     |

Table 3. DMM Performance Tests: 110/114/115/116/117 (cont.)

| Step | Function                                                                                          | Range    | Applied                    | Display Reading <sup>[1]</sup> |     |                |     |     |
|------|---------------------------------------------------------------------------------------------------|----------|----------------------------|--------------------------------|-----|----------------|-----|-----|
|      |                                                                                                   |          |                            | 110                            | 114 | 115            | 116 | 117 |
| 9.   |  Continuity      | 600 Ω    | 20 Ω                       | Beeper On                      |     |                |     |     |
| 10.  |                                                                                                   | 600 Ω    | 250 Ω                      | Beeper Off                     |     |                |     |     |
| 11.  |  AC Volts        | 6.000 V  | 5 V, 45 Hz                 | 4.947 to 5.053                 |     |                |     |     |
| 12.  |                                                                                                   | 6.000 V  | 5 V, 1 Hz                  | 4.897 to 5.103                 |     |                |     |     |
| 13.  |                                                                                                   | 60.00 V  | 50 V, 45 Hz                | 49.47 to 50.53                 |     |                |     |     |
| 14.  |                                                                                                   | 60.00 V  | 50 V, 1 Hz                 | 48.97 to 51.03                 |     |                |     |     |
| 15.  |                                                                                                   | 600.0 V  | 600 V, 45 Hz               | 593.7 to 606.3                 |     |                |     |     |
| 16.  |                                                                                                   | 600.0 V  | 600 V, 1 Hz                | 587.7 to 612.3                 |     |                |     |     |
| 17.  |  AC Volts + Hz   | 6.000 V  | 2 V, 50 kHz <sup>[1]</sup> | NA                             |     | 49.93 to 50.07 |     |     |
| 18.  |  DC Volts      | 6.000 V  | 0 V                        | -0.002 to 0.002                |     |                |     |     |
| 19.  |                                                                                                   | 6.000 V  | 5 V                        | 4.973 to 5.027                 |     |                |     |     |
| 20.  |                                                                                                   | 60.00 V  | 50 V                       | 49.73 to 50.27                 |     |                |     |     |
| 21.  |                                                                                                   | 600.0 V  | 600 V                      | 596.8 to 603.2                 |     |                |     |     |
| 22.  |                                                                                                   | 600.0 V  | -600 V                     | -596.8 to -603.2               |     |                |     |     |
| 23.  |  AC Millivolts | 600.0 mV | 6 mV, 45 Hz                | 5.6 to 6.4                     |     |                |     |     |
| 24.  |                                                                                                   | 600.0 mV | 600 mV, 1 kHz              | 587.7 to 612.3                 |     |                |     |     |
| 25.  |  DC Millivolts | 600.0 mV | 10 mV                      | 5.6 to 6.4                     |     |                |     |     |
| 26.  |                                                                                                   | 600.0 mV | 600 mV                     | 587.7 to 612.3                 |     |                |     |     |
| 27.  |  Diode         | 2.000 V  | 1.9 V                      | NA                             |     | 1.881 to 1.919 |     |     |
| 28.  |  Capacitance   | 1000 nF  | Open                       | NA                             |     | 0 to 2         |     |     |
| 29.  |                                                                                                   | 9999 μF  | 900 μF                     | NA                             |     | 881 to 919     |     |     |
| 30.  | LoZ Capacitance                                                                                   | 10.00 μF | 9 μF                       | NA                             |     | 7.18 to 10.82  |     |     |

Table 3. DMM Performance Tests: 110/114/115/116/117 (cont.)

| Step                                                                      | Function                                                                                           | Range                                                                               | Applied                       | Display Reading <sup>[1]</sup> |                                        |                |                                        |                                        |
|---------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|-------------------------------|--------------------------------|----------------------------------------|----------------|----------------------------------------|----------------------------------------|
|                                                                           |                                                                                                    |                                                                                     |                               | 110                            | 114                                    | 115            | 116                                    | 117                                    |
| Set calibrator to standby, reconfigure leads, and program for amps output |                                                                                                    |                                                                                     |                               |                                |                                        |                |                                        |                                        |
| 31.                                                                       | <br>DC Amps       | 10.00 A                                                                             | 10 A                          | NA                             |                                        | 9.87 to 10.13  | NA                                     | 9.87 to 10.13                          |
| 32.                                                                       | <br>AC Amps       | 6.000 A                                                                             | 5.0 A, 45 Hz                  | NA                             |                                        | 4.922 to 5.078 | NA                                     | 4.922 to 5.078                         |
| 33.                                                                       | <br>DC $\mu$ Amps | 600.0 $\mu$ A                                                                       | 600 $\mu$ ADC                 | NA                             |                                        |                | 593.8 to 606.2                         | NA                                     |
| 34.                                                                       | <br>DC $\mu$ Amps | 600.0 $\mu$ A                                                                       | 600 $\mu$ AAC, 45 HZ          | NA                             |                                        |                | 590.7 to 609.3                         | NA                                     |
| 35.                                                                       | <br>Temperature   | ---                                                                                 | Open input                    | NA                             |                                        |                | OPEN                                   | NA                                     |
| 36.                                                                       |                                                                                                    | ---                                                                                 | 0.0 °C                        | NA                             |                                        |                | -1.0 to 1.0                            | NA                                     |
| 37.                                                                       |                                                                                                    | ---                                                                                 | 400 °C                        | NA                             |                                        |                | 395.0 to 405.0                         | NA                                     |
| 38.                                                                       | AUTO-V<br>LoZ                                                                                      | ---                                                                                 | 0.5 V, 45 Hz                  | NA                             | 0.2 to 0.8,<br>AC<br>Annunciator<br>On | NA             | 0.2 to 0.8,<br>AC<br>Annunciator<br>On | 0.2 to 0.8,<br>AC<br>Annunciator<br>On |
| 39.                                                                       |                                                                                                    | ---                                                                                 | 0.5 v, 0 Hz                   | NA                             | 0.2 to 0.8,<br>AC<br>Annunciator<br>On | NA             | 0.2 to 0.8,<br>AC<br>Annunciator<br>On | 0.2 to 0.8,<br>AC<br>Annunciator<br>On |
| 40.                                                                       |                                                                                                    | ---                                                                                 | 500 V <sup>[2]</sup> , 500 Hz | NA                             | 489.7 to 510.3                         | NA             | 489.7 to 510.3                         | 489.7 to 510.3                         |
| 41.                                                                       | VoltAlert                                                                                          |  | ---                           | NA                             |                                        |                |                                        | [3]                                    |
| 42.                                                                       | VoltAlert                                                                                          |  | ---                           | NA                             |                                        |                |                                        | [4]                                    |

[1] If using a Fluke 9100 calibrator, the Calibrator Frequency mode must be used to obtain accurate frequency.

[2] To keep from tripping the calibrator to standby, ramp up the voltage in 50 V increments with a 5 second delay between increments.

[3] See steps 1-5 in *Testing the VoltAlert Function (117 only)*.

[4] See steps 6-9 in *Testing the VoltAlert Function (117 only)*.

Table 4. DMM Performance Tests: 113

| Step | Function                         | Range                  | Applied       | Display Reading          |
|------|----------------------------------|------------------------|---------------|--------------------------|
| 1.   | $\Omega$<br>Ohms                 | 600.0                  | 0.0 $\Omega$  | 0.0 to 0.2 (2-Wire comp) |
| 2.   |                                  | 600.0                  | 500 $\Omega$  | 495.3 to 504.7           |
| 3.   |                                  | 6.000 k                | 5 k $\Omega$  | 4.954 to 5.046           |
| 4.   |                                  | 60.00 k                | 50 k $\Omega$ | 49.54 to 50.46           |
| 5.   | <i>CHEK</i><br>Continuity        | NA                     | 20 $\Omega$   | Beeper On                |
| 6.   |                                  | NA                     | 250 $\Omega$  | Beeper Off               |
| 7.   | <i>CHEK</i> Diode Test           | NA                     | 1.9 V         | 1.859 to 1.941           |
| 8.   | <i>CHEK</i> Volts <sup>[1]</sup> | 6.000 V                | 0.1 V         | 0.095 to 0.105           |
| 9.   |                                  | 6.000 V                | 5 V           | 4.897 to 5.103           |
| 10.  |                                  | 6.000 V                | -5 V          | -5.103 to -4.897         |
| 11.  |                                  | 6.000 V                | 5 V, 45 Hz    | 4.897 to 5.103           |
| 12.  |                                  | 6.000 V                | 5 V, 1 kHz    | 4.797 to 5.203           |
| 13.  |                                  | 60.00 V                | 50 V          | 48.97 to 51.03           |
| 14.  |                                  | 60.00 V                | -50 V         | -51.03 to -48.97         |
| 15.  |                                  | 60.00 V                | 50 V, 500 Hz  | 48.97 to 51.03           |
| 16.  |                                  | 60.00 V                | 50 V, 1 kHz   | 47.97 to 52.03           |
| 17.  |                                  | 600.0 V <sup>[2]</sup> | 600 V         | 587.7 to 612.3           |
| 18.  |                                  | 600.0 V <sup>[2]</sup> | -600 V        | -612.3 to -587.7         |
| 19.  |                                  | 600.0 V <sup>[2]</sup> | 600 V, 45 Hz  | 587.7 to 612.3           |
| 20.  |                                  | 600.0 V <sup>[2]</sup> | 600 V, 1 kHz  | 575.7 to 624.3           |
| 21.  | Capacitance                      | 1000 nF                | Open          | 0 to 2                   |
| 22.  |                                  | 9999 $\mu$ F           | 900 $\mu$ F   | 881 to 919               |

[1] Manually select the range by pressing **RANGE** .

[2] To keep from tripping the calibrator to standby, ramp up the voltage in 50 V increments with a five-second delay between increments.

## Testing the VoltAlert Function (117 only)

Use this procedure to verify that VoltAlert functions properly.


### Note

- Make sure the instrument is REMOVED from the holster before you do the test.
- Keep the Meter away from electrical noise sources during the tests, for example, florescent lights, dimming lights, and motors. These types of noise source can trigger VoltAlert and invalidate the test.
- It may be necessary in steps 4 and 8 below to slightly adjust the Meter position for maximum signal strength to get the Meter beeper to sound continuously.

Refer to Figure 4 for these steps:

1. Select the VoltAlert function and verify that **Hi** is on the display. Verify that the beeper is silent and the red LED is off.
2. Connect a double banana plug to the output voltage terminals of the calibrator (Fluke 5500A or equivalent).
3. Set the calibrator output to 10 V at 60 Hz.
4. Hold the Meter so that the top is vertically and horizontally centered and contacting the banana plug Hi terminal. Verify that the Meter beeper is on continuously and the red LED at the top of the display lights.
5. Place the calibrator in standby mode and verify that the beeper is now silent and the red LED is off.
6. Press **RANGE** (display should indicate **Lo** range).
7. Set the calibrator output to 30 V at 60 Hz.

Figure 4. VoltAlert Test

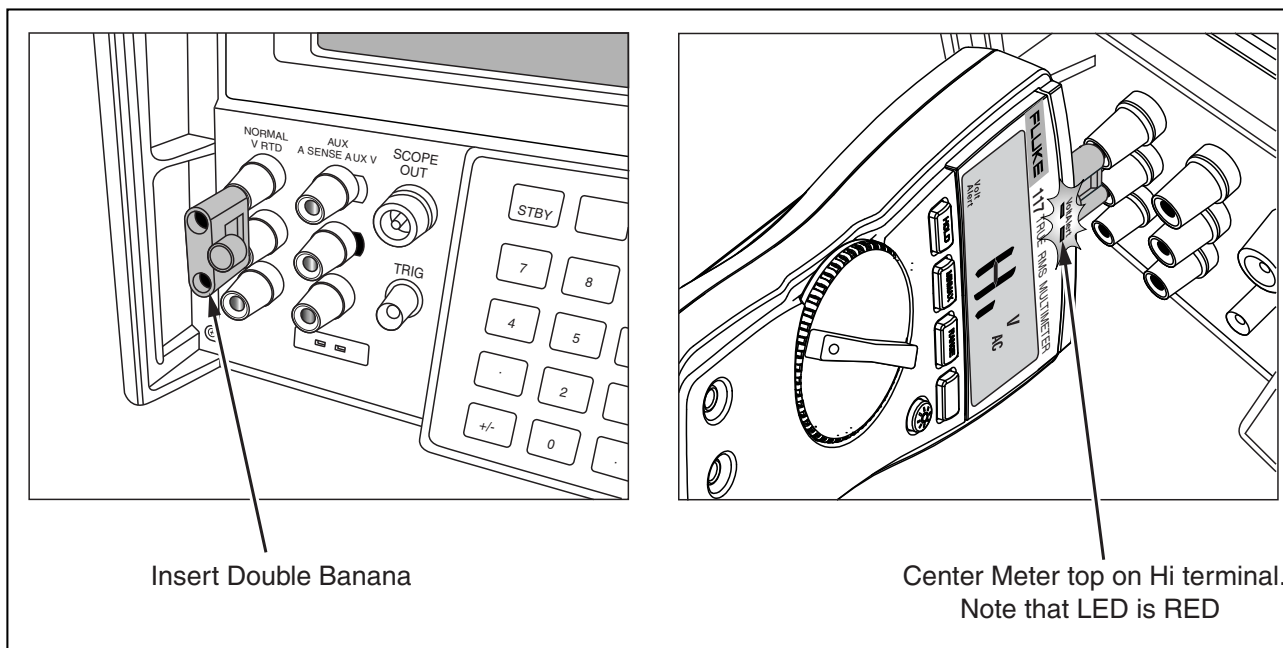


8. Hold the Meter so that the top is vertically and horizontally centered to the banana plug Hi terminal. Verify that the Meter beeper is sounding continuously and the red LED at the top of the display lights.
9. Return the calibrator to standby mode and verify the Meter beeper is silent and the red LED is off.

For Fluke 117 with S/N 38920290 through 42913406, use this alternate calibration procedure to verify that VoltAlert functions properly. See Figure 5.

1. Select the VoltAlert function:
  - a. Verify that **Hi** is on the display.
  - b. Verify that the beeper is silent and the red LED is off.
2. Connect wire (Pomona 4911A-12-2 or equivalent) to the High output voltage terminals of the calibrator (Fluke 5500A or equivalent).
3. Set the calibrator output to 10 V at 60 Hz.
4. Hold the Meter so that the wire contacts and runs across the top center of the unit. The wire should run perpendicular to the face of the unit (front to back of Meter, not side to side). Verify that the Meter beeper is on continuously and the red LED, at the top of the display, lights up.
5. Place the calibrator in standby mode and verify that the beeper is silent and the red LED is off.
6. Press **RANGE**.  
Display should indicate **Lo** range.
7. Set the calibrator output to 30 V at 60 Hz.
8. Hold the Meter so that the wire contacts and runs across the top center of the unit. The wire should run perpendicular to the face of the unit (front to back of Meter, not side to side). Verify that the Meter beeper is on continuously and the red LED, at the top of the display, lights up.
9. Return the calibrator to standby mode and verify the Meter's beeper is silent and the red LED is off.

**Figure 5. Volt Alert Test (Alternate)**

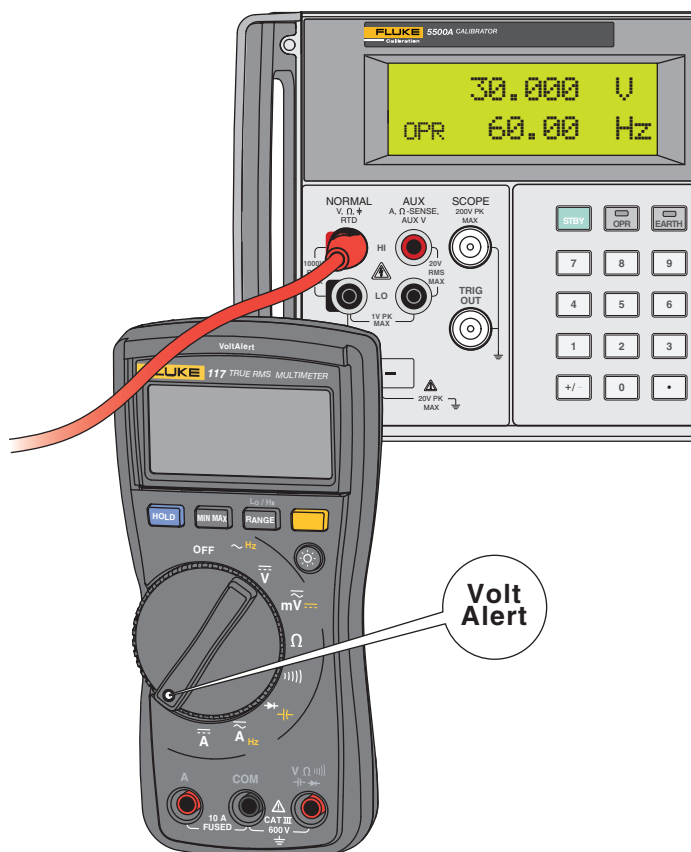

## Calibration Adjustment

The Meter features closed-case calibration adjustment using known reference sources. The Meter measures the applied reference source, calculates correction factors, and stores the correction factors in nonvolatile memory. The following sections present the features and Meter pushbutton functions available during the Calibration Adjustment Procedure. Should the Meter fail any of the performance tests, perform the Calibration Adjustment Procedure.

### 110/114/115/116/117

Use these steps to view the Meter calibration counter:

1. While pressing **HOLD**, turn the rotary switch from **OFF** to  $\Omega$  function. The Meter should display  $\zeta RL$ .
2. Press  once to view the calibration counter. For example,  $n00 l$ .
3. Turn the rotary switch to **OFF**.

### 113

1. While pressing , turn the rotary switch from **OFF** to  $\Omega$  function. The Meter should display  $\zeta RL$ .
2. Press  once to view the calibration counter. For example,  $n00 l$ .
3. Turn the rotary switch to **OFF**.

## Calibration Adjustment Password

To start the Calibration Adjustment Procedure, the correct 4-digit password must be entered. The default password is 1234. The password can be changed or reset to the default as described in following paragraphs.

### Changing the Password

Use these steps to change the Meter password:

1. **110/114/115/116/117:**

While pressing **HOLD**, turn the rotary switch from **OFF** to  $\Omega$  function.

#### 113:

While pressing , turn the rotary switch from **OFF** to  $\Omega$  function.

The Meter should display  $\zeta RL$ .

2. Press  once to see the calibration counter.
3. Press  again to start the password entry.

The Meter displays  $????$ .

The Meter buttons indicated below represent the numbers 1 through 5 when you enter or change the password:

**HOLD** = 1    **MIN MAX** = 2     = 3     = 4     = 5

4. Press 4 buttons to enter the current password. To change the password for the first time, enter **HOLD** (1), **MIN MAX** (2),  (3), and  (4).
5. Press  to change the password.  
The Meter displays ---- if the entered password is correct. If the password is not correct, the Meter emits a double beep, displays  $????$ , and the password must be entered again. Repeat step 4.
6. Press the 4 buttons of the new password.
7. Press  to store the new password.

### **Restoring the Default Password**


If the calibration password is forgotten, the default password (1234) can be manually restored:

#### **⚠⚠ Warning**

**To prevent electric shock or personal injury, remove the test leads and any input signal before removing the Meter's back case.**

1. Remove the Meter back case. Leave the PCA in the top case.
2. Apply 9.0 V across the battery contacts (XBT1) + and (XBT2) – on the back of the PCA. See Figure 6.
3. Turn the rotary switch from **OFF** to any **ON** position.
4. Short across the S7 CAL keypad on the back of the PCA. See Figure 6. The Meter should beep. The default password is now restored.
5. Remove the 9.0 V supply and replace the Meter back case.

**Figure 6. Calibration Password Reset**

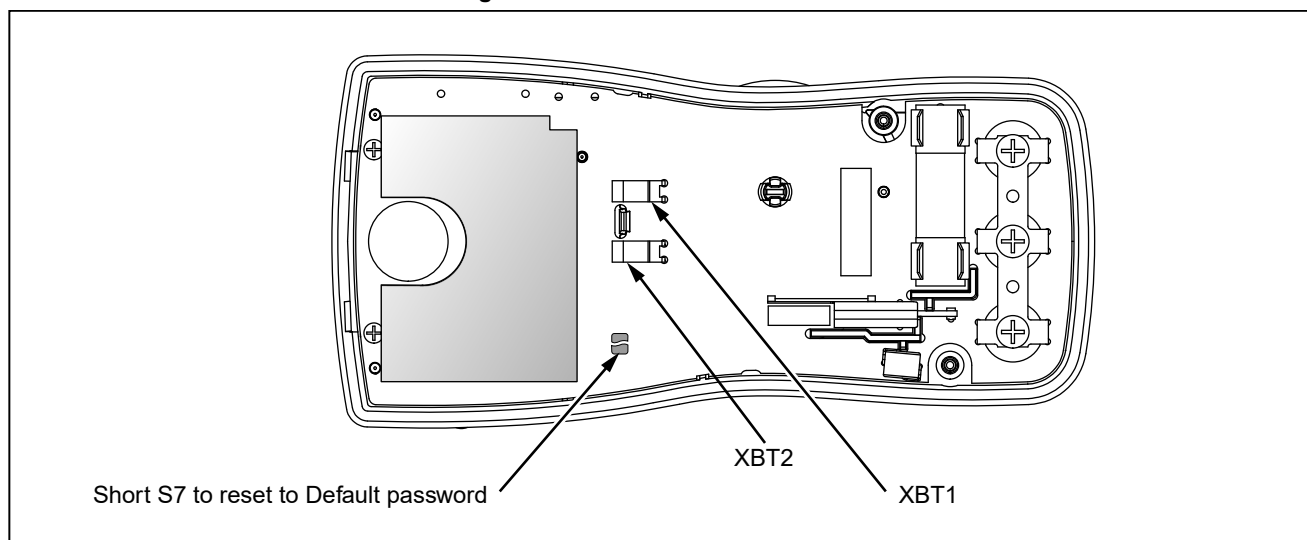

## Meter Buttons Used in the Calibration Steps

For the Calibration Adjustment Procedure, the Meter buttons behave as follows:

- Press and hold **HOLD** to show the measured value. The measured value is not calibrated so it may not match the input value. This is normal.
- Press and hold **MIN MAX** to display the required input value.
- Press  to store the calibration value and advance to the next step. This button is also used to exit calibration mode after the calibration adjustment sequence is complete.
- Press  to toggle the backlight on and off.

This can be useful to determine why a calibration step is not accepted and to determine the input value without referring to Table 5.

## Calibration Adjustment Procedure

### Note

*If you turn off the Meter before completion of the adjustment procedure, the calibration constants do not change.*

To adjust the Meter calibration:

#### 1. 110/114/115/116/117:

While pressing **HOLD**, turn the rotary switch from **OFF** to  $\Omega$  function.

#### 113:

While pressing  , turn the rotary switch from **OFF** to  $\Omega$  function.

The Meter should display  $\frac{1}{2}$  RL.

#### 2. Press once to see the calibration counter.

#### 3. Press again to start the password entry.

The Meter displays  $\overline{9999}$ .

#### 4. Press the 4-button password.

#### 5. Press to go to the first calibration step. The Meter displays if the password is correct. If the password is not correct, the Meter emits a double beep, displays $\overline{9999}$ and the password must be entered again. Repeat step 4.

#### 6. Apply the input value listed for each calibration adjustment step. For each step, select the rotary switch position and apply the input to the terminals as indicated in Table 5 and Table 6.

### Note

*Some adjustment steps require additional wait time after the calibrator settles, as noted in Table 5 and Table 6.*

#### 7. After each input value is applied, press to accept the value and proceed to the next step ( $\overline{0002}$ ).

### Note

*After you press  , wait until the step number advances before you change the calibrator source or turn the rotary switch. Some adjustment steps can take up to several seconds to execute before the next step.*

*If the rotary switch is not in the correct position for a given step, the meter will flash the unit annunciators until the rotary switch is put in a valid position. The keys that show the reading and required input values are not allowed until the rotary switch is correct.*

*If the rotary switch is not in the correct position or the measured value is not within the anticipated range of the input value, the Meter will emit a double beep and will not continue to the next step when you press .*

After the final step, the display shows End to indicate that the calibration adjustment is complete.

#### 8. Press to return to meter mode.

*Note*

*Set the calibrator to Standby before you change the function switch position and after you complete adjustment of each function.*

*If the calibration adjustment procedure is not properly completed, the Meter will not operate correctly.*

**Table 5. Calibration Adjustment Steps (110/114/115/116/117)**

| Rotary Switch Position | Display Reading |                    |                    |                       | Input Terminals       | Calibrator Source Value      |
|------------------------|-----------------|--------------------|--------------------|-----------------------|-----------------------|------------------------------|
|                        | 110/114         | 115 <sup>[1]</sup> | 116 <sup>[1]</sup> | 117 <sup>[1, 2]</sup> |                       |                              |
| $\Omega$<br>Ohms       | NA              | ┐00┐               | ┐00┐               | ┐00┐ <sup>[2]</sup>   | no leads              | no leads                     |
| $\tilde{V}$            | ┐00┐            | ┐002┐              | ┐002┐              | ┐002┐                 | V $\Omega$ /+ and COM | 0 V, 0 Hz                    |
|                        | ┐002┐           | ┐003┐              | ┐003┐              | ┐003┐                 | V $\Omega$ /+ and COM | 300 mV, 0 Hz                 |
|                        | ┐003┐           | ┐004┐              | ┐004┐              | ┐004┐                 | V $\Omega$ /+ and COM | 100 mV, 0 Hz                 |
|                        | ┐004┐           | ┐005┐              | ┐005┐              | ┐005┐                 | V $\Omega$ /+ and COM | -300 mV, 0 Hz                |
|                        | ┐005┐           | ┐006┐              | ┐006┐              | ┐006┐                 | V $\Omega$ /+ and COM | 60 mV, 0 Hz                  |
|                        | ┐006┐           | ┐007┐              | ┐007┐              | ┐007┐                 | V $\Omega$ /+ and COM | 600 mV, 0 Hz                 |
|                        | ┐007┐           | ┐008┐              | ┐008┐              | ┐008┐                 | V $\Omega$ /+ and COM | 600 MV, 60 Hz                |
| $\Omega$<br>Ohms       | ┐008┐           | ┐009┐              | ┐009┐              | ┐009┐                 | V $\Omega$ /+ and COM | 600 $\Omega$ , 2-wire comp   |
|                        | ┐009┐           | ┐010┐              | ┐010┐              | ┐010┐                 | V $\Omega$ /+ and COM | 6 k $\Omega$                 |
|                        | ┐010┐           | ┐011┐              | ┐011┐              | ┐011┐                 | V $\Omega$ /+ and COM | 60 k $\Omega$                |
|                        | ┐011┐           | ┐012┐              | ┐012┐              | ┐012┐                 | V $\Omega$ /+ and COM | 600 k $\Omega$               |
|                        | ┐012┐           | ┐013┐              | ┐013┐              | ┐013┐                 | V $\Omega$ /+ and COM | 6 M $\Omega$ <sup>[3]</sup>  |
|                        | ┐013┐           | ┐014┐              | ┐014┐              | ┐014┐                 | V $\Omega$ /+ and COM | short <sup>[3]</sup>         |
|                        | ┐014┐           | ┐015┐              | ┐015┐              | ┐015┐                 | V $\Omega$ /+ and COM | 40 M $\Omega$ <sup>[3]</sup> |
| $\tilde{V}$            | ┐015┐           | ┐016┐              | ┐016┐              | ┐016┐                 | V $\Omega$ /+ and COM | 6 V, 60 Hz                   |
|                        | ┐016┐           | ┐017┐              | ┐017┐              | ┐017┐                 | V $\Omega$ /+ and COM | 60 V, 60 Hz                  |
|                        | ┐017┐           | ┐018┐              | ┐018┐              | ┐018┐                 | V $\Omega$ /+ and COM | 600 V, 60 Hz                 |
|                        | ┐018┐           | ┐019┐              | ┐019┐              | ┐019┐                 | V $\Omega$ /+ and COM | 6 V, 0 Hz                    |
|                        | ┐019┐           | ┐020┐              | ┐020┐              | ┐020┐                 | V $\Omega$ /+ and COM | 60 V, 0 Hz                   |
|                        | ┐020┐           | ┐021┐              | ┐021┐              | ┐021┐                 | V $\Omega$ /+ and COM | 600 V, 0Hz                   |

**Table 5. Calibration Adjustment Steps (110/114/115/116/117) (cont.)**

| Rotary Switch Position                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Display Reading |                    |                    |                       | Input Terminals | Calibrator Source Value   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|--------------------|--------------------|-----------------------|-----------------|---------------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | 110/114         | 115 <sup>[1]</sup> | 116 <sup>[1]</sup> | 117 <sup>[1, 2]</sup> |                 |                           |
| Set calibrator to standby, reconfigure leads, and program for amps output.                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                 |                    |                    |                       |                 |                           |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                   | NA              | [ 022              | NA                 | [ 022                 | A and COM       | 6 A, 60 Hz <sup>[3]</sup> |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                   | NA              | [ 023              | NA                 | [ 023                 | A and COM       | 6 A, 0 Hz                 |
| <br>DC $\mu$ Amps                                                                                                                                                                                                                                                                                                                                                                                                                                 | NA              | NA                 | [ 022              | NA                    | + and COM       | 600 $\mu$ A, 60 Hz        |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | NA              | NA                 | [ 023              | NA                    | + and COM       | 600 $\mu$ A, 0 Hz         |
| <div>[1] Models listed in this column also refer to the “C” version of the model. For example, model 115 steps are valid for the 115C.</div> <div>[2] Do not calibrate the 117 or 117C with a line-frequency power source nearby (for example, fluorescent light or power strip). These devices can produce errors in the VoltAlert calibration.</div> <div>[3] Wait an additional 5 seconds after calibrator has settled before pressing .</div> |                 |                    |                    |                       |                 |                           |

**Table 6. Calibration Adjustment Steps (113)**

| Rotary Switch Position                                                                                                                | Calibration Steps | Input Terminals | Calibrator Source Value     |
|---------------------------------------------------------------------------------------------------------------------------------------|-------------------|-----------------|-----------------------------|
|  <i>CHEK</i><br>mV ac/dc                           | [ - 01            | + and COM       | 0 V, 0 Hz                   |
|                                                                                                                                       | [ - 02            | + and COM       | 300 mV, 0 Hz                |
|                                                                                                                                       | [ - 03            | + and COM       | 100 mV, 0 Hz                |
|                                                                                                                                       | [ - 04            | + and COM       | -300 mV, 0 Hz               |
|                                                                                                                                       | [ - 05            | + and COM       | 60 mV, 0 Hz                 |
|                                                                                                                                       | [ - 06            | + and COM       | 600 mV, 0 Hz                |
|                                                                                                                                       | [ - 07            | + and COM       | 600 mV, 60 Hz               |
| $\Omega$<br>Ohms                                                                                                                      | [ - 08            | + and COM       | 600 $\Omega$ , 2-wire comp  |
|                                                                                                                                       | [ - 09            | + and COM       | 6 k $\Omega$                |
|                                                                                                                                       | [ - 10            | + and COM       | 60 k $\Omega$               |
|                                                                                                                                       | [ - 11            | + and COM       | 600 k $\Omega$              |
|  <i>CHEK</i><br>V ac                               | [ - 12            | + and COM       | 6 V, 60 Hz                  |
|                                                                                                                                       | [ - 13            | + and COM       | 60 V, 60 Hz                 |
|                                                                                                                                       | [ - 14            | + and COM       | 600 V, 60 Hz <sup>[1]</sup> |
| [1] To keep from tripping the calibrator to standby, ramp up the voltage in 50 V increments with a 5 second delay between increments. |                   |                 |                             |

## Replacement Parts

See Table 7 and Figure 7 for information about replaceable parts.

**Table 7. Replacement Parts**

| Item | Description                                                                   | Part Number | QTY |
|------|-------------------------------------------------------------------------------|-------------|-----|
| ①    | LCD,FLUKE-11X,3.2V,TN,4-DIGIT,1/4-DUTY,1/3-BIAS,LEPTON                        | 2509955     | 1   |
| ②    | CONNECTOR,ELASTOMERIC,.010 IN CTR,.218 IN HIGH,.090 IN THK,2.284 IN LONG,BULK | 2534229     | 1   |
| ③    | FLUKE-117-2006,BRACKET MASK, 117                                              | 2525608     | 1   |
|      | FLUKE-117-2006-06,BRACKET MASK, 117 China                                     | 2631059     | 1   |
|      | FLUKE-117-2006-08,BRACKET MASK, 113                                           | 3088082     | 1   |
|      | FLUKE-117-2006-01,BRACKET MASK, 114                                           | 2527431     | 1   |
|      | FLUKE-117-2006-02,BRACKET MASK, 115                                           | 2527446     | 1   |
|      | FLUKE-117-2006-04,BRACKET MASK, 115 China                                     | 2631032     | 1   |
|      | FLUKE-117-2006-03,BRACKET MASK, 116                                           | 2527454     | 1   |
|      | FLUKE-117-2006-05,BRACKET MASK, 116 China                                     | 2631044     | 1   |
| ④    | FLUKE-117-8005,DIFFUSER, BACKLIGHT                                            | 2535203     | 1   |
| ⑤    | FLUKE-117-2001,CASE TOP, 117                                                  | 2525553     | 1   |
|      | FLUKE-117-2001-07,CASE TOP, 110                                               | 5166573     | 1   |
|      | FLUKE-117-2001-04,CASE TOP, 113                                               | 3092058     | 1   |
|      | FLUKE-117-2001-01,CASE TOP, 114                                               | 2527405     | 1   |
|      | FLUKE-117-2001-02,CASE TOP, 115                                               | 2527410     | 1   |
|      | FLUKE-117-2001-03,CASE TOP, 116                                               | 2527422     | 1   |
| ⑥    | FLUKE-117-2008,KNOB                                                           | 2525624     | 1   |
| ⑦    | FLUKE-117-7602,RSOB HOUSING ASSEMBLY                                          | 2787083     | 1   |
| ⑧    | FLUKE-117-8001,KEYPAD                                                         | 2526276     | 1   |
| ⑨    | FLUKE-117-2009,SPRING DETENT                                                  | 2525636     | 1   |
| ⑩    | FLUKE-117-8009,SHIELD, TOP                                                    | 2571277     | 1   |
| ⑪    | FLUKE-117-8010,IC SHIELD                                                      | 2571292     | 1   |
| ⑫    | O-RING,NITRILE,SHORE A 70,15.6MM OD,12.0MM ID,1.8MM W                         | 2535215     | 1   |

**Table 7. Replacement Parts (cont.)**

| Item      | Description                                                                 | Part Number | QTY                              |
|-----------|-----------------------------------------------------------------------------|-------------|----------------------------------|
| ⑬         | FLUKE-117-2002,CASE BOTTOM                                                  | 2525566     | 1                                |
|           | FLUKE-117-2002,CASE BOTTOM, 11X China                                       | 2631098     | 1                                |
| ⑭ ⑳       | FLUKE-117-2003,BATTERY DOOR,TILT STAND                                      | 2720600     | 1                                |
|           | FLUKE-117-2003,BATTERY DOOR, TILT STAND, 11X China                          | 2720617     | 1                                |
| ⑮         | SCREW,2-28,.250,PAN,PHILLIPS,STEEL,ZINCCHROMATE, PLASTITE 48 THREAD FORMING | 2516493     | 4                                |
| ⑯         | SCREW,M3,4MM,PAN,PHILLIPS,STEEL,ZINC-CHROMATE                               | 2032811     | 2 (114, 110, 116)<br>3 (115,117) |
| ⑰         | SCREW,5-14,.750,PAN,PHILLIPS,STEEL,BLACK CHROMATE, THD FORMING              | 832246      | 2                                |
| ⑱         | SCREW,M3X0.5,6MM,PAN,PHILLIPS,STEEL,ZINC-BLACK CHROMATE                     | 2032792     | 1                                |
| ⑲         | BATTERY,PRIMARY,MNO2-ZN,9V,505MAH,6LR61, ALKALINE, 17X26X48MM,BULK          | 614487      | 1                                |
| ㉔         | FLUKE 12-8004,SHOCK ABSORBER                                                | 878983      | 1                                |
| ㉒         | FLUKE-117-2010,HOLSTER                                                      | 2525649     | 1                                |
|           | FLUKE-117-2010,HOLSTER, 11X China                                           | 2631080     | 1                                |
| ㉓         | FUSE,11A,1000V,FAST.406INX1.5IN,BULK                                        | 803293      | 1 (115, 117)                     |
| not shown | 110/113/114/115/117 Users Manual                                            |             |                                  |
| not shown | 116 Users Manual                                                            |             |                                  |

Figure 7. Exploded View of Meter

